



Service Bulletin: 26/10/2013	#SB131026i
Product:	SpeedLink
Issue:	Can't connect SpeedLink to iPad via ADHOC network connection
Reasoning:	A bug exists in the current iOS 6 with iPad 3 units, resulting in the non-availability of the IP address used by SpeedLink. A workaround requires the manual input of these parameters. Future iOS6 releases should overcome this problem.

If your iPad Speedlight Application is not connecting to the Speedlink Device, please check that an IP address has been allocated by accessing the **Settings/Wifi** dialog on your iPad and pressing the small blue arrow to the right of the SpeedLink Wifi network as indicated by the red arrow in the image below.

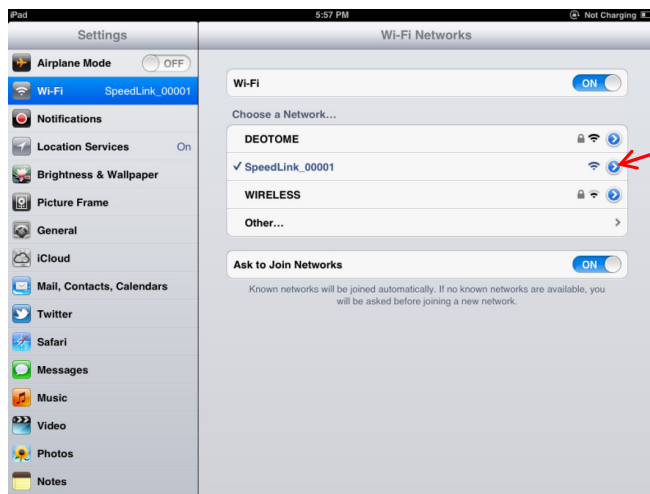

1. Your SpeedLink device must be turned on. (Press the red button until the Status light comes on, then release the button)
2. Tap on the Blue arrow as indicated
3. If the three fields IP Address, Subnet Mask and Router are empty, enter the values as shown below

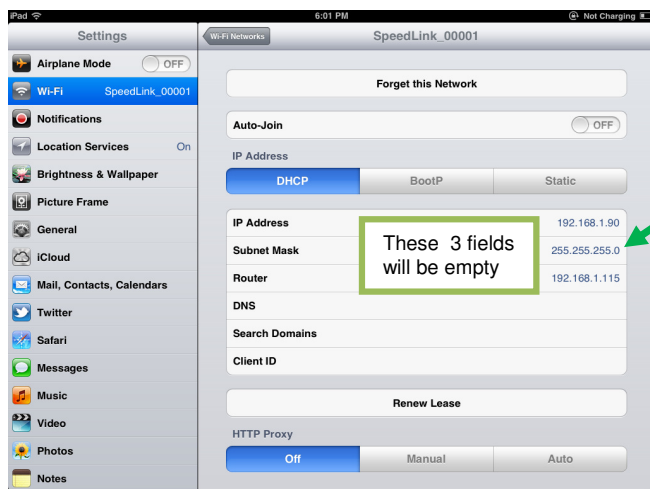

This workaround will not be required once Apple Release a fix.